

# Precision Zero Air 18L


ガスジェネレータ

品番: 60-0019 (110V) | 60-0018 (230V)



## 説明

Precision Zero Air発生装置は、標準検出限界と微量検出限界レベルの両方で、GCのフレームサポートガスとして使用される炭化水素フリーの清潔で乾燥したエアを供給するように特別に設計されています

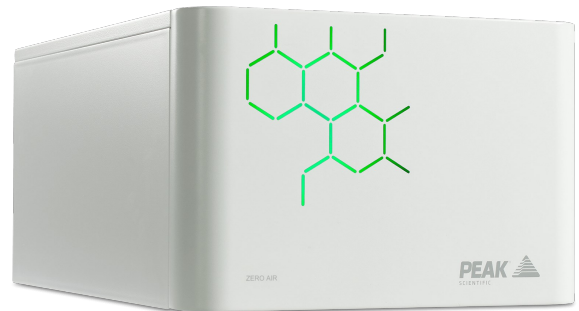


## Generator Details

- ガスの種類: 空気
- 統合型コンプレッサ: 番号

## 主な機能

- 既存のPrecision製品と統合し、同じモジュール式の積み重ね可能なデザイン
- 炭化水素含有量(メタンとして) <math>\lt; \lt; \text{市場をリードする純度で} 0.05\text{ppm}</math>
- 最大18L / minのゼロエア最大80psi / 5.5barの出口圧力
- 最小限のメンテナンス要件、高価な触媒チャンバーの交換なし
- 汚染物質がシステムに侵入するリスクが大幅に減少し、ガスが不足するリスクがない
- スタイリッシュで現代的な美学と機能的なデザイン
- ステータスを示す照明機能(黄色のウォームアップ、緑の準備完了)
- Precision Air Compressorと互換性がある
- 12か月の包括的なオンサイト保証

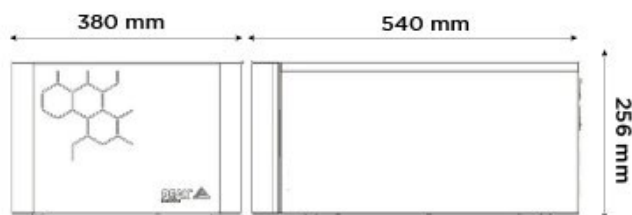

## 技術仕様

Precision Zero 空気18L - ガスジェネレータ	
ガスの種類	空気
最大ガス流量:	18L/min
最大出口圧力:	80psi/5.5bar
炭化水素の含有量:	<0.05ppm
最大出口圧力:	80psi/5.5bar
ガス出口の設定:	1 x 1/4" BSPP
最低入口圧力:	110psi/7.6bar
最高入口圧力:	125psi/8.6bar
Min Air Inlet Flow:	18L
最小入口空気品質:	ISO 8753-1:2010 Class 1.4.1 or Precision Air Compressor
起動時間:	60 mins
消費電力:	594 / 759 W
電圧:	110 / 230 V
周波数:	50 / 60 Hz
電流:	3.3 - 5.4 A
熱出力:	2590
認証:	CE, FCC, CSA
大きさ (高さx幅x奥行き) ミリメートル	256 x 380 x 540 mm
大きさ (高さx幅x奥行き) インチ	10.1 x 15 x 21.3 inches
装置の重量	25kg / 55lbs

# [PEAK Protected]<sup>TM</sup>

Peak Scientific gas generators define the benchmark in reliability, convenience and performance in laboratories around the world, and come backed with a 12 month warranty. Beyond this period however you can ensure that your investment continues to be **[Protected]** by our comprehensive generator care cover.

Our world-class aftercare support packages deliver a program of scheduled preventative maintenance whilst giving you the reassurance of instant access to worldwide technical support and priority on-site response in the untimely event of a breakdown.

- For ordering parts visit: [www.peakscientific.com/ordering/](http://www.peakscientific.com/ordering/)
- For service plans visit: [www.peakscientific.com/service/service-plans/](http://www.peakscientific.com/service/service-plans/)

**Peak Scientific UK**  
Tel: +44 (0)141 812 8100  
Fax: +44 (0)141 812 8200

**Peak Scientific North America**  
Tel: +1-800-767-6532  
Fax: +1-978-608-9503

**Peak Scientific China**  
Tel: +86 21 5079 1190  
Fax: +86 21 5079 1191  
For a full list of our worldwide office locations, please visit:  
Web: [www.peakscientific.com](http://www.peakscientific.com)  
Email: [discover@peakscientific.com](mailto:discover@peakscientific.com)

Peak Scientific's Quality Management System conforms to: ISO:9001

